OT RANGE ADAMS COUNTY C

PUBLIC LAND SURVEY MONUMENT RECORD

CALCULATED POSITION TYPE OF MONUMENT:_ ADAMS COUNTY COORDINATES, NAD 83 (2007)

N. 314249.664

E. 577954.068


ELEVATION-DATUM

12/09/2019 FIELD WORK DATE:


BASIS FOR MONUMENT LOCATION

1982 - PLS 878 NO RESURVEYS OF RECORD. ANY EVIDENCE OF THIS CORNER DESTROYED BY DITCHING. CORNER SET BY DOUBLE PROPORTIONATE MEASURE BETWEEN THE SW CORNER OF SECTION 3 AND THE SE CORNER OF SECTION 2 FOR EAST-WEST LOCATION AND BETWEEN THE W1/4 CORNER OF SECTION 1 AND THE W1/4 CORNER SECTION 11 FOR NORTH-SOUTH LOCATION. NO HARRISON SET AS CORNER FALLS IN DITCH.

2019 - PLS 2675 CALCULATED POINT FROM THE W1/4 OF SECTION 11 OF 2644.97' PER SECTION 11 SUMMARY BY ABK. THE INVERSE BACK TO THE SOUTH WITNESS IS 25.01' AND RECORDED ON THE 1982 TIE SHEET AS 25.00'. THE EAST MEANDER CORNER ON THE 1982 TIE SHEET IS LOST. NO CALCULATIONS FIT THE NORTH WITNESS, BUT IT DOES NOT APPEAR TO BE DISTURBED. CSM 5305 SHOWS THE SE CORNER OF SECTION 3 TO BE A PK NAIL, WHICH IS NOT POSSIBLE. THE DISTANCE ON CSM 5305 DOES NOT FIT THE NORTH WITNESS AND E1/4 OF SECTION 3. ACCEPTED THE CALCULATED POSITION AS THE BEST EVIDENCE OF THE CORNER LOCATION. SET 2 NEW TIES AND MEASURED TO THE EXISTING TIES.

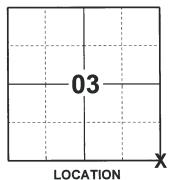

(INDICATE CORNER BY "X")

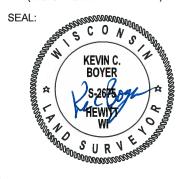

DATA SHOWN HERE ON THIS TIE SHEET IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

PROFESSIONAL LAND SURVEYOR 2020

-TIE SKETCH -



OPEN BFRM N0° 39' 50"W OPEN 14.50 DITCH TOP OF SLOPE OPEN **OPEN**

- SET 3/4" x 18" IRON REBAR, 1.50#/FT
- FOUND 2-3/8" O.D. IRON PIPE W/ADAM CO. ALUMINUM CAP
- CALCULATED POSITION
- → VINYL "T" POST

Government Land Corner Certificate CORNER NO. ADAMS County **SECTION** TYPE OF MONUMENT: 2" IRON PIPE WITNESSES 20 **TOWN** STATE PLANE COORDINATES: N. RANGE ELEVATION - M.S.L. DATUM: . THETA ANGLE: _ 88 PAGE _/33 FIELD BOOK: ____ S.Z.H. DRAWN BY: ____ BASIS FOR MONUMENT LOCATION ANTHONY B. KIEDROWSKI S-878 Wisconsin Rapids, Wis. HERE (PECT: Show info such as: History of corner, with reference to Vol. and pg., dates, surveyor; exact description of monument replaced; if location computed, by taped or EDM traverse; landowner remarks, etc. (Use reverse side if necessary) SEAL: No resurveys of record. Any evidence of this corner destroyed by ditching. Corner set by double proportionate measure between the SW corner of Section 3 and the SE corner of Section 2 for East-West location and between the W_4 corner of Section 1 and the W^{1}_{4} corner of Section 11 for North-South location. No Harrison set as corner falls in ditch. 0k 5-2-84 SS-DK DATA SHOWN HERE ON CERTIFIED CORRECT: Registered Land Surveyor DATE: 5-25-82 TIE SKETCH Show at least four ties, also fence lines, roads, topo, size and type of witness trees' and if off road - best way to arrive at corner. SEC. LI

33.00

N. 88'01'23"E.

Ditch bank

Ditcl

MAINTENANCE RECORD

DATE	BY WHOM	REMARKS
A JUN 94	JG-CR	0/5
2-12-99	TG	OK
9-01-04	55	
07-07-69	55	OK
-,		