# 06 RANGE ADAMS COUNTY COUNTY CORNER NO: 88 ROMPORTOL ID: 41706220020

## PUBLIC LAND SURVEY MONUMENT RECORD

TYPE OF MONUMENT: 2-3/8" O.D. IRON PIPE W/ALUMINUM CAP ADAMS COUNTY COORDINATES, NAD 83 (2007)

N. **202987.464** 

E. 544339.326


DATUM **ELEVATION-**

09/19/2018 FIELD WORK DATE:


#### BASIS FOR MONUMENT LOCATION

1980 - PLS 1167 CALCULATED THE CORNER LOCATION EQUIDISTANT ON LINE BETWEEN ADJACENT SECTION CORNERS. AN EXTENSIVE SEARCH REVEALED NO CONCLUSIVE EVIDENCE AS TO THE LOCATION OF THE ORIGINAL CORNER OR ANY REMONUMENTATION, SET A 54"x2" GAL. PIPE W/ALUMINUM CAP AT THE CALCULATED POSITION AND TIED OUT.

2018 - PLS 2675 FOUND A 2-3/8" O.D. IRON PIPE WITH AN ALUMINUM CAP 18" ABOVE THE GROUND SURFACE. FOUND NO EVIDENCE OF ANY OF THE EXISTING TIES OR WITNESSES. VERIFIED THE 2-3/8" O.D. IRON PIPE WITH AN ALUMINUM CAP TO BE ON LINE AND EQUIDISTANT BETWEEN THE ADJACENT SECTION CORNERS. ACCEPTED THE 2-3/8" O.D. IRON PIPE WITH AN ALUMINUM CAP AS THE BEST EVIDENCE OF THE CORNER LOCATION. SET 4 NEW TIES AND MEASURED TO THE TIES.

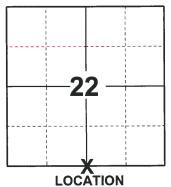

(INDICATE CORNER BY "X")

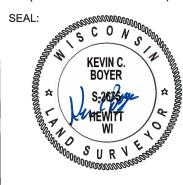

DATA SHOWN HERE ON THIS TIE SHEET IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

PROFESSIONAL LAND SURVEYOR

12/4/2018

#### -TIE SKETCH

NOTE: THE CORNER FALLS 35'± WEST OF THE CENTERLINE OF THE TRAIL.



MARSH MIXED WOODS عللد N83° 04' 04"W MARSH عللد عللد عالد

- SET 3/4" x 18" IRON REBAR, 1.50#/FT
- FOUND 2-3/8" O.D. IRON PIPE W/ALUMINUM CAP
- → VINYL "T" POST

$\wedge$ 1	corner no. <u>88</u>
Adams County	SECTION 27
YPE OF MONUMENT: 54"xz" Gal. Pipe w/aluminum Cap.	TOWN
TATE PLANE COORDINATES: N	RANGE GE
LEVATION — M.S.L. DATUM:	
HETA ANGLE:	1
IELD BOOK: PAGE	
PRAWN BY: Boster	
ASIS FOR MONUMENT LOCATION	
how info such as: History of corner, with reference to Vol. nd pg., dates, surveyor; exact description of monument	
pg, dates, surveyor, exact description or monument spelaced; if location computed, by taped or EDM traverse; indowner remarks, etc. (Use reverse side if necessary)	LOCATION
SEA	(Indicated by 'X')
Set Corner equidistant on line between adjacent	WAYNE BASLER  1167  WIS. RAPIDS,  WIS.
section corners, an extensive search revealed	A Commence of the Commence of
to conclusive evidence as to the location of the original corner or any remonumentation	
shereof.	WAYNE BASLER
	1167
1-10-90 OK SS	WIS. RAPIDS, WIS.
ALL OK, 12-06-00 -JG	Nanage Control of the
2-NEW TIES 3-31-05 55 Z NEW TIES 1-20-10 55	SURV
· ·	
	ATA SHOWN HERE ON ERTIFIED CORRECT:
	Val R.
	gistered Land Surveyor
	gistered Land Surveyor  ATE: 3-3-80
DA .	- •
TIE SKETCH TAKE BRUSHED LINE TO TRAIL Q TO ALL	3-3-80
TE SKETCH  TAKE BRUSHED LINE TO TRAIL  TRAIL  How at least four ties, also fence lines, roads, topo, size  A 5"BURR	DEAD SPK. 12" OOK / blo
TE SKETCH  TAKE BRUSHED LINE TO TRAIL  EAST  how at least four ties, also fence lines, roads, topo, size and type of witness trees' and if off road - best way to  TRAIL  TRAIL  OAK  TRAIL  OAK  TO  OAK	DEAD SPK. 12" OOK / blo
TE SKETCH  TAKE BRUSHED LINE TO TRAIL  FAST  How at least four ties, also fence lines, roads, topo, size and type of witness trees' and if off road - best way to  rive at corner.  THE SKETCH  TRAIL  TRAIL  TRAIL  S''BURP  OAK  TO TRAIL  TRA	DEAD SPK. 12" OOK / blo
TIE SKETCH  TAKE BRUSHED LINE TO TRAIL  EAST  how at least four ties, also fence lines, roads, topo, size and type of witness trees' and if off road - best way to  rrive at corner.  O"WHITE PINE SPK. IBOAK  A TN60°W  blazed DEAD  O N.2	DEAD  DEAD  DEAD  OF A D  OF A
TE SKETCH  TAKE BRUSHED LINE TO TRAIL  TRAIL	DEAD  DEAD  DEAD  OF A D  OF A
TE SKETCH  TAKE BRUSHED LINE TO TRAIL  How at least four ties, also fence lines, roads, topo, size and type of witness trees' and if off road - best way to  TRAIL  S'BURR  OAK  TRAIL  SPR. IBOAK  A TRACE  SPR. IBOAK  TRACE  SPR. IBOAK  TRACE  SPR. IBOAK  TRACE  SPR. IBOAK  A TRACE  SPR. IBOAK  TRACE  SPR. IBOAK  TRACE  SPR. IBOAK  SPR. IBOAK  TRACE  SPR. IBOAK  SPR. IBOAK  TRACE  SPR. IBOAK  SPR. IB	DEAD  DEAD  DEAD  OF A D  OF A
THE SKETCH  TAKE BRUSHED LINE TO TRAIL  FOR ALL  LAST  how at least four ties, also fence lines, roads, topo, size and type of witness trees' and if off road - best way to rrive at corner.  O"WHITE PINE SPK. TBOAK  A TRACE  SO MAPLE  SO SURVEY MARKER  (facing E)  CHAPLE  CALL  TRAIL  TRAIL  TRAIL  GAST  A OLD  SO SURVEY MARKER  (facing E)	DEAD  DEAD  DEAD  OF A D  OF A
THE SKETCH  TAKE BRUSHED LINE TO TRAIL  How at least four ties, also fence lines, roads, topo, size and type of witness trees' and if off road - best way to  THE SKETCH  TRAIL  FAST  TRAIL  S'BURR  OAK  O" WHITE PINE SPR. IBOAK  A TRACE  S'MAPLE	DEAD  DEAD  DEAD  OF A D  OF A
THE SKETCH  TAKE BRUSHED LINE TO TRAIL  FOR ALL  LAST  how at least four ties, also fence lines, roads, topo, size and type of witness trees' and if off road - best way to rrive at corner.  O"WHITE PINE SPK. TBOAK  A TRACE  SO MAPLE  SO SURVEY MARKER  (facing E)  CHAPLE  CALL  TRAIL  TRAIL  TRAIL  GAST  A OLD  SO SURVEY MARKER  (facing E)	DEAD  DEAD  DEAD  OF A D  OF A
THE SKETCH  TAKE BRUSHED LINE TO TRAIL  How at least four ties, also fence lines, roads, topo, size  nd type of witness trees' and if off road - best way to  rrive at corner.  O"WHITE PINE SPR. IBOAK  A INGO W blazed DEAD  598.3' TRACE  S' MAPLE	DEAD  DEAD  DEAD  OF A D  OF A
THE SKETCH  TAKE BRUSHED LINE TO TRAIL  How at least four ties, also fence lines, roads, topo, size and type of witness trees' and if off road - best way to  TRAIL  S'BURR  OAK  O'WHITE PINE SPK. IBOAK  A TRAILE  S'MAPLE  S'MAPLE  S'MAPLE  S'MAPLE  S'MAPLE  S'MAPLE  S'SIGN  (facing E)  SPL. G'OAK  blazed  STEEL POST  Y  STEEL POST	DEAD  DEAD  DEAD  O'' BU  DAK  DAK  10''  40''  DEAD  DEAD  O'' BU  DAK  DAK  DAK  DAK  DAK  DAK  DAK  DA
THE SKETCH  TAKE BRUSHED LINE TO TRAIL  How at least four ties, also fence lines, roads, topo, size  nd type of witness trees' and if off road - best way to  rrive at corner.  O"WHITE PINE SPR. IBOAK  A TRAIL  SO DEAD  SPR. IBOAK  SPR	DEAD  DEAD  DEAD  SPK. 12"OOK / blo  OAK  40'F  40'F
THE SKETCH  TAKE BRUSHEN LINE TO TRAIL  FAST  How at least four ties, also fence lines, roads, topo, size and type of witness trees' and if off road - best way to  FINALL SPECIAL SPECIAL STEPPE  STEEL POST  YZW. OF PIPE	DEAD  DEAD  DEAD  O'' BU  DAK  DAK  DAK  DAK  DAK  DAK  DAK  DA
TE SKETCH  TAKE BRUSHEN LINE TO TRAIL  How at least four ties, also fence lines, roads, topo, size  nd type of witness trees' and if off road - best way to  TRAIL  STEEL POST  YZW. OF PIPE  TRAIL  T	DEAD  DEAD  DEAD  O'' BU  DAK  DAK  DAK  DAK  DAK  SOUTH  SOUTH

### MAINTENANCE RECORD

DATE	BY WHOM	REMARKS
10-29-85	BERNING - SORENSEN	REBLAZED ALL TREES - HAD PREVIOUSLY BEEN BLAZED AT BASE OF TREES,
1		
<del></del>		