SECTION

DOT RANGE ADAMS COUNTY

COUNTY CORNER NO: 02

ROMPORTOL ID: 42007069020

PUBLIC LAND SURVEY MONUMENT RECORD


1" OD IRON PIPE (NO CAP) TYPE OF MONUMENT: ADAMS COUNTY COORDINATES, NAD 83 (2007) N. 321184.760 E. 559319.799 DATUM - -ELEVATION-FIELD WORK DATE: 2/27/2017

BASIS FOR MONUMENT LOCATION

1976 - PLS 878 SET A 1" OD IRON PIPE WITH ALUMINUM HIGHWAY CAP ON A LINE BETWEEN THE SE AND SW CORNERS OF SECTION 31-21-7 AT 2640 FEET WEST OF THE NE CORNER OF SECTION 6. THIS CORNER WAS NOT SET IN THE ORIGINAL SURVEYS.

1991 - L.L ALLISON FOUND THE 1" IRON PIPE MISSING CAP, SET 4 ALUMINUM CAPED BERNTSEN MONUMENTS AS TIES WITH MARKERS.

2017 - PLS 2994 FOUND EXISTING 1" OD IRON PIPE 6 INCHES BELOW THE ROAD AND 4 EXISTING TIES. THE 1" IRON PIPE AGREES WITH THE TIES AND ACCEPTED THE 1" OD IRON PIPE. REMEASURED TO EXISTING TIES AND A FOUND PROPERTY IRON TO THE SOUTH.

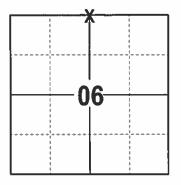

LOCATION (INDICATE CORNER BY "X")

SEAL: RUTZEN, JA S-2994 MOSINE

DATA SHOWN HERE ON THIS TIE SHEET IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

PROFESSIONAL LAND SURVEYOR


- TIE SKETCH

NOTE: THE CORNER FALLS 3'± SOUTH OF THE CENTERLINE OF STH 73.



 3/4" x 18" IRON REBAR SET, 1.50#/FT **ALUMINUM CAPPED BERNTSEN FOUND** 1" OD IRON PIPE FOUND

→ VINYL "T" POST -4 EXISTING STEEL POST

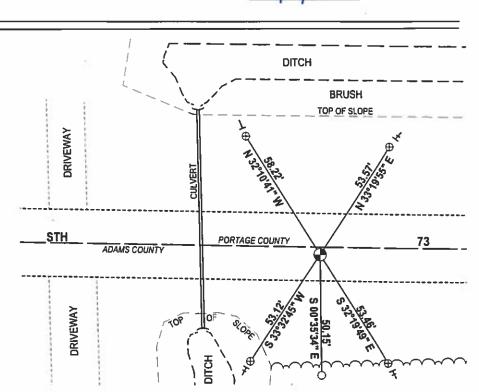

State of Wisconsin | Department of Transportation



istrict Project 1. 0.		Located by		·		· · · · · · · · · · · · · · · · · · ·	
4 63	21-02-71	<u> </u>	<u>L. L. Alliso</u>		<u> </u>		
Ther 1/4 6 SECTION	Township 20 N	Range (E,W)	Count	Adam			
sconsin Coordinates	East (X)		North (Y)	7,8(3,7,1	Elevation (Z)		Zone
CORNER ntrol Station Name	Fact (V)		M. A. (34)	····			
mor Signon Rams	East (X)		North (Y)		Elevation (Z)		Zone
rizontal — NORTH AI	MERICAN, 1927	CONTROL	Vertical — ME	EAN SEA LE	/EL, 1929 ADJU	JSTMENT	
rizontal —	Order ·	SURVEY	CONTROL Vertical —		Order		
		SKE	TCH cose	11			
ernten Mon. Witness Channer	Ditch		TCH 582° 2 D= 60	2051 E		, · · ·	sten N
211.11	70		<u> </u>	, 15		$ \langle \mathcal{M} \rangle$	+ncss
	100	100 E-12) 3 [©]	51021		n an ne
	· /	6-12		0			·
		-	7 / Y	127±	<u> </u>		.T.H.
	>		(<i>A</i> 1 <i>U</i>	,	SW	تن صح 3i (
ATION SKETCH	N		136/1/2	Alum. Hwy cap.	' ·	T211	J 27
ation of landmark W	C	/				00	•
discarded by "x") $(0, \frac{\Lambda}{\Lambda})$,	5700		N.			
	536	5700 W		0,7	3.00	3°59'03" = 89, 81	ķ
		•	•	,	90 3. 73 79 "	=	
Man		S 85°	4 7'13"E 7.99'	·		- 7	
rness channel	R/w/=	D=57	7.99'	Ber	nsten Mon.		·
hereby certify the	/ 🗸	ath day of	Nisch	W/W	lithess char	inel	
that I did locate	the above co	rner which w	as evidence				*
Hum. Highway							
	I further ce						
ation of such cor	ner I did, a	t the exact	location	ALL OK	3-28-9	74 JG.6	se 1
, place a permane	nt marker co	nsisting of		OK	2-22-99-J	7	1
	. T f		- T 323			ري.	
in 4 references	or witness	certify that	r i ara		•	•	ķ
Bernstein Mo	Or writiess a	COLUMETICS COL	raractua				Ī
THE TAXABLE PARTY OF	**************************************	Mark			SEAL		
	located as	shown above:				•	,
			-				[
		0	tion No	7:11-			<u>[</u>
gnature.Registered Land	Surveyor	Registra S —	tion No.	Title			
		1 J -					

CORNER NO. . ADAMS COUNTY SECTION Survey Monument Record 20 TOWN TYPE OF MONUMENT: Aluminum highway disc. 7 RANGE STATE PLANE COORDINATES: N_ ELEVATION - M.S.L. DATUM: _ THETA ANGLE: _ FIELD BOOK: ___ 45 PAGE ___ BASIS FOR MONUMENT LOCATION (Use reverse side if necessary) Show info such as: History of corner, with reference to Vol. and pg, dates, surveyor; exact description of monument replaced; if location computed, by taped or EDM traverse; landowner SEAL: remarks, etc. Set on line between the SE and SW corners of Section 31-21-7 and at 2640' west of the NE corner of Sec. 6. Note: This corner was not set in the original surveys. TIES & MON. O.K. 3-23-79 D.W. - R.N. ALSO 3-29-91 SEE ATTACHED PAGE CERTIFIED CORRECT: hay Black TIE SKETCH (Show at least four ties) PORTAGE CO. CHANNEL "SCOTCH R/0/W CHANNEL 16

ADAMS

(BT)

REVISED 1974