## ADAMS COUNTY COUNTY CORNER NO: 102

ROMPORTOL ID: 41507300020

## PUBLIC LAND SURVEY MONUMENT RECORD

HARRISON (BROKEN-TOP) TYPE OF MONUMENT:\_ ADAMS COUNTY COORDINATES, NAD 83 (2007)

N. 138213.491

E. 560026.268

- — — \_ DATUM\_ ELEVATION-


04/27/2021 FIELD WORK DATE:

## BASIS FOR MONUMENT LOCATION

1977 - FOUND NO RESURVEYS OF RECORDS PERTINENT TO THIS CORNER. CORNER FALLS IN LARGE CULTIVATED FIELD AND THERE WAS NO REMAINING EVIDENCE AS TO WHERE THE ORIGINAL GOVERNMENT 1/4 POST WOULD BE. RESET THIS CORNER BY THE SINGLE PROPORTION METHOD AS OUTLINED IN THE B.L.M. MANUAL OF INSTRUCTIONS, USED AN EDM-THEODOLITE TRAVERSE.

1996 - PLS 2021 FOUND HARRISON MONUMENT LYING ON THE GROUND IN PIECES NEXT TO IRRIGATION WELL. SET ROD BASED ON DISTANCE FROM ZIETLOW SECTION SUMMARY FOR 31-15-7, DATED 8-24-77. ROD SET 24" BELOW GROUND SURFACE.

2021 - PLS 2675 FOUND HARRISON (BROKEN TOP) MONUMENT 18" BELOW GROUND SURFACE AND 1 WITNESS FROM 1977 TIE SHEET BY PLS 922. DID NOT RECOVER 3/4" IRON ROD SET BY PLS 2021 SET IN 1996, BUT FOUND 3 OF HIS WITNESSES FOR HIS SET CORNER. DID NOT ACCEPT PLS 2021 CORNER LOCATION SINCE HARRISON (BROKEN TOP) MONUMENT WAS RECOVERED AND THE WITNESS DISTANCE AGREES WITH THE MONUMENT, ACCEPTED HARRISON (BROKEN TOP) MONUMENT AS THE CORNER LOCATION. DUE TO CORNER LOCATION I USED 2 FOUND PROPERTY IRONS, A SECTION CORNER AND 2 CORNERS OF EXISTING PIVOTS FOR TIES.

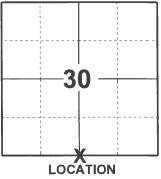

(INDICATE CORNER BY "X")



DATA SHOWN HERE ON THIS TIE SHEET IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

PROFESSIONAL LAND SURVEYOR

- TIE SKETCH

NOTE 1: PLS 2021 CORNER LOCATION FALLS S 05°35'08" W, 7.45' FROM FOUND HARRISON.

NOTE 2: HARRISON MONUMENT IS 18" BELOW GROUND SURFACE.



FIELD N75° 07' 05"E 1368.60 SW CORNER SECTION 30 S89° 51' 21"E S89° 39' 29"W 1322.24 2323.05 24"W 137 22 S FIELD NE CORNER CENTER OF OLD OF PIVOT

- O FOUND 3/4" IRON ROD
- FOUND HARRISON (BROKEN TOP) MONUMENT
- STEEL FENCE POST
- FOUND SECTION CORNER

	CORNER NO	848
ADAMS COUNTY Survey Monument Record	SECTION _	29
TYPE OF MONUMENT: 34 X24 1800 BAR, HARRISON TO BE SET SPRING 1976	TOWN _	15 N
STATE PLANE COORDINATES: N	RANGE _	7 E
STATE PLANE COORDINATES: N		
ELEVATION — M.S.L. DATUM:		
THETA ANGLE:		- 4
FIELD BOOK: PAGE		N
BASIS FOR MONUMENT LOCATION		
(Use reverse side if necessary)	<u> </u>	
Show info such as: History of corner, with reference to Vol. and pg, dates, surveyor; exact description of monument replaced; if location computed, by taped or EDM traverse; landowner  SEAL:	LOCATION (Indicated by 'X')	,
FOUND MOUND & TRIANGULAR FORMATION OF STONES,	MINIMINA	
NO RECORD OF THIS IN ADAMS COUNTY SURVEY	"I'M BOOKSIV"	The state of the s
RECORDS. FIT EDM. TRAVERSE OF SECTION	FREDERIC	
Good.	TIFTLOW	1 =
Corner & ties O.K. 6-20-76 GR-SS	FREDERIC W.  ZIETLOW S-922 Baraboo WIS.	* =
	Baraboo	10-E
MAINTENANCE RECORD	WIS.	0,73
Date Init. Remarks	WO SURVE	
12-29-81 TH-NJ O.K	willing.	
7-3-86 GE-55 OK		
4-11-90 CARLSON & K	D CORRECT:	
11-12-91 56-LR TIES OK. Fred	Peris W. Za	idou
Registered	Land Surveyor	- con-
7-9-06 JG 44L OK DATE: _	1-15-76	
7-16-11 50 1 NOW.		
TIE SKETCH  (Show at least four ties)  UPPER MOST POINT OF 3'XH' BOULDER  JANUAL IRON BARN BARN  1 POINT OF 3'XH' BOULDER		4 N
150.40,		