


PLAT OF SURVEY

Located in
Block 54, First Addition To The Dellwood, Blocks 53 & 60, Third Addition
To The Dellwood, Section 7, T17N, R5E, Adams County, Wisconsin.

Client: Wisconsin River Power Co., PO Box 850, Wisconsin Rapids, WI
CARLSON SURVEYING, 127 10th. Ave., Baraboo, WI 53913. Tel 608-356-3816.

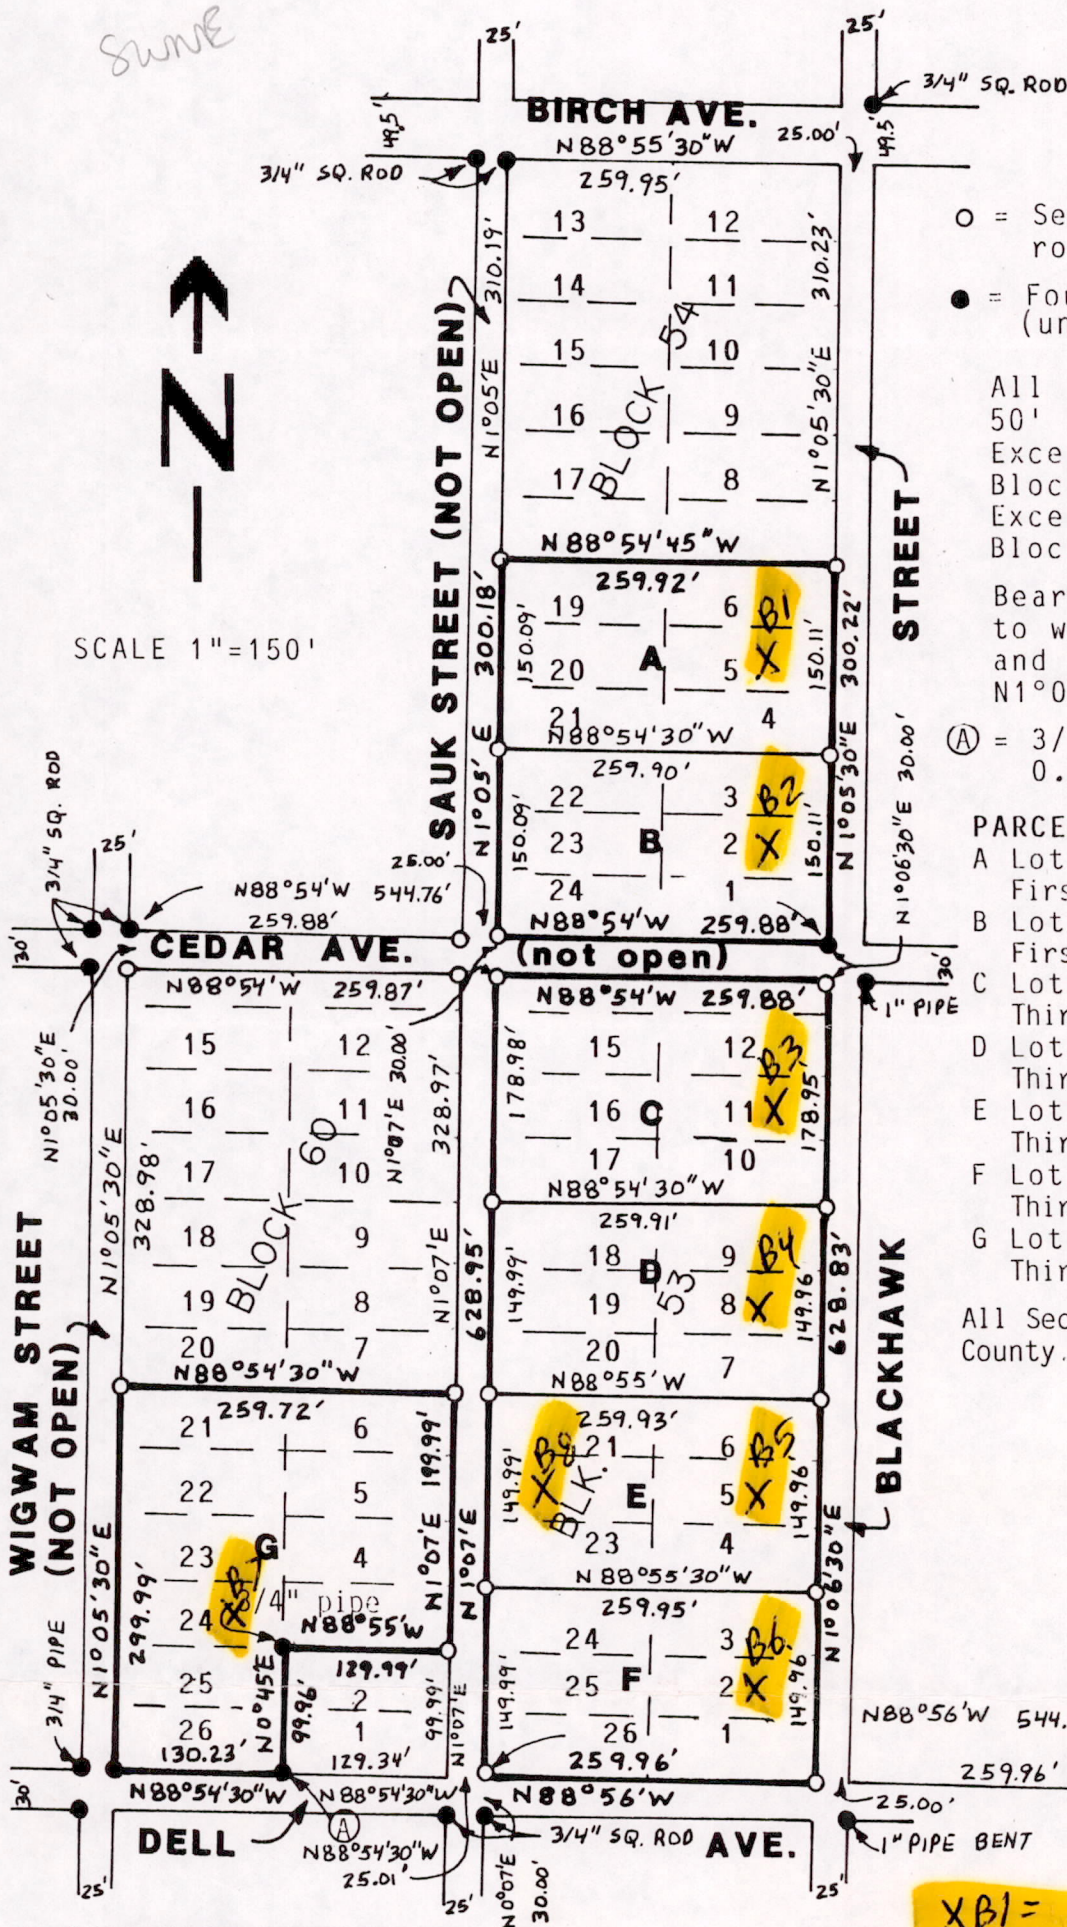

- = Set 3/4"x24" round iron rod weighing 1 5#/lin. ft.
- = Found 3/4" iron rod (unless shown otherwise)

All lots recorded as 50' x 130'
Except Lots 12 & 13
Block 54 = 60' x 130'
Except Lots 13 & 14,
Block 53 & 60 = 29' x 130'


Bearings are referenced to west line of Block 54 and assumed to bear N1°05'E.

Ⓐ = 3/4" rod is N0°45'E, 0.30' from corner.

PARCEL DESCRIPTIONS:

- A Lots 4-6 & 19-21, Block 54 First Addition To The Dellwood
- B Lots 1-3 & 22-24, Block 54 First Addition To The Dellwood
- C Lots 10-17, Block 53 Third Addition To The Dellwood
- D Lots 7-9 & 18-20 Block 53 Third Addition To The Dellwood
- E Lots 4-6 & 21-23, Block 53 Third Addition To The Dellwood
- F Lots 1-3 & 24-26, Block 53 Third Addition To The Dellwood
- G Lots 3-6 & 21-26, Block 60 Third Addition To The Dellwood

All Section 7, T17N, R5E, Adams County, Wisconsin.

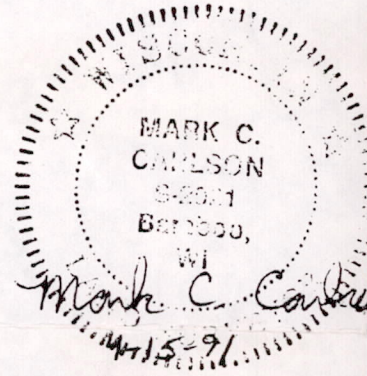

X B1 = Boring Location
4-30-91

SURVEYORS CERTIFICATE:

I, Mark C. Carlson, registered land surveyor, hereby certify that I have surveyed, staked and mapped the above described parcels and have complied with the provisions of A-E 7 of the Wisconsin Administrative Code to the best of my knowledge, information and belief.

4-15-91
Date

Mark C. Carlson
Mark C Carlson

Pos 07170511007

26-1606

NOTE: Original Typed, Printed Or Written Form Must Be Submitted
REPORT ON SOIL BORINGS AND PERCOLATION TESTS

26-2372-10

26-2372

DEPARTMENT OF INDUSTRY, LABOR AND HUMAN RELATIONS, DIVISION OF SAFETY AND BUILDINGS
(Pursuant to H 65.06, Wisconsin Administrative Code)

NAME OF SUBDIVISION Block 54, First Addition To The Dellwood & Blocks 53 & 60, Third Addition To The Dellwood

LOCATION OF SUBDIVISION: TOWN X OF Quincy COUNTY Adams SECTION 7; TOWN 17 N; RANGE 5^E
(Check One)

NAME OF OWNER Wisconsin River Power Company
ADDRESS PO Box 50, Wisconsin Rapids WI 54494
(Number & Street) (Place) (State) (Zip Code)

NAME OF SUBDIVIDER SAME AS ABOVE
ADDRESS _____
(Number & Street) (Place) (State) (Zip Code)

SUBDIVISION WATER SUPPLY FROM: PUBLIC WATER SUPPLY _____ PRIVATE WELLS X

SUBDIVISION DATA: AREA IN ACRES 7.0 NUMBER OF LOTS 7 MINIMUM LOT AREA, SQUARE FEET 39,000

DISTANCE TO NEAREST NAVIGABLE SURFACE WATER 200 FEET. (IF WITHIN 1/2 MILE)

NAME OF LAKE OR STREAM Castle Rock Lake

DATES OBSERVATIONS MADE: SOIL BORINGS 4-30-91 PERCOLATION TESTS _____

SOIL BORING TESTS

TEST NUMBER	TOTAL DEPTH INCHES	DEPTH TO GROUND WATER, INCHES		CHARACTER OF EACH SOIL LAYER WITH THICKNESS IN INCHES
		OBSERVED	ESTIMATED HIGHEST	
B 1	72	-	>72	8" ls 7.5YR 3/1, 16" ls 7.5YR 3/4, 12" ls 7.5YR 5/8, 24" fs 7.5YR 7/4, 12" med s 7.5YR 7/8
B-				
B 2	72	-	>72	12" ls 7.5YR 3/1, 12" ls 7.5YR 4/4, 12" ls 7.5YR 6/8, 36" fs 10YR 7/6
B-				
B 3	72	-	>72	6" ls 7.5YR 3/1, 20" fs 7.5YR 4/4, 52" fs 10YR 7/6
B-				
B 4	72	-	>72	6" ls 7.5YR 3/1, 12" ls 7.5YR 4/4, 12" fs 7.5YR 5/6, 42" fs 10YR 7/6
B-				
B 5	112	-	>112	6" ls 7.5YR 3/1, 12" ls 7.5YR 4/4, 12" fs 7.5YR 5/6, 82" fs 10YR 7/6, fmd mots @ 42" + ↓
B-				
B 6	72	-	>72"	8" ls 7.5YR 3/1, 10" ls 7.5YR 4/4, 10" fs 7.5YR 5/6, 38" fs 10YR 7/6, 6" med s 10YR 7/4
B-				
B 7	72	-	>72"	4" ls 7.5YR 3/1, 28" ls 7.5YR 5/6, 40" fs 10YR 7/4
B-				
B 8	72	-	>72"	8" ls 7.5YR 3/1, 11" ls 7.5YR 4/4, 11" fs 10YR 6/6, 42" fs 10YR 7/4
B-				
B	Ran out of auger on #5 before we found groundwater.			
B	Ground water is controlled by lake level and			
B	mottling must not indicate seasonal saturation			
B	in this case.			
B				
B				
B				

NOTE: IF SPACE IS INADEQUATE TO REPORT ALL SOIL BORINGS, USE ADDITIONAL FORMS.
DILHR SBD-6 309 (N. 12/80)

OVER

Pos 07170511007

PERCOLATION TESTS

TEST NUMBER	DEPTH INCHES	CHARACTERS OF SOIL THICKNESS IN INCHES*	HOURS SINCE HOLE 1ST WETTED	WATER IN HOLE AFTER SWELLING	TEST TIME INTERVAL IN MINUTES	DROP IN WATER LEVEL, INCHES			MINUTES TO FALL ONE INCH
						SECOND TO LAST PERIOD	NEXT TO LAST PERIOD	LAST PERIOD	
P-									
P		None Taken							
P		soils are	loamy	sand	or	fine	sand		
P-									
P-									
P									
P-									
P									
P-									
P									
P-									
P									
P									
P									
P									
P									
P									
P									
P									
P									
P									
P									
P									
P									
P									
P									
P									
P									
P									
P									
P									
P									
P									
P									
P									
P									

*DEPTH IS TO BE REPORTED ON BASIS OF FINAL GRADE

NOTE: IF SPACE IS INADEQUATE TO REPORT ALL PERCOLATION TESTS, USE ADDITIONAL FORMS.

I, THE UNDERSIGNED, UNDER PENALTY OF PERJURY, HEREBY CERTIFY THAT THE SOIL BORINGS AND PERCOLATION TESTS REPORTED ON THIS FORM WERE MADE BY ME IN ACCORD WITH THE PROCEDURES AND METHODS SPECIFIED IN CHAPTER H 65, WISCONSIN ADMINISTRATIVE CODE, AND THAT THE DATA RECORDED ARE CORRECT TO THE BEST OF MY KNOWLEDGE AND BELIEF.

NAME MARK CARLSON (Type or Print) TITLE AND CST NO. 3622

ADDRESS 127 10th Ave Baraboo, WI, 53913

DATE 5-17-91 SIGNATURE Mark Carlson