
## **U.S. PUBLIC LAND SURVEY MONUMENT RECORD**

INSTRUCTIONS: This record shall show the location of the corner and shall include all of the following nine elements (a through i).

(a) Identify the corner by reference to the U.S. Public Land Survey System.

= Corner monument restored.

SOUTH QUARTER CORNER OF SECTION 25, TOWNSHIP 20 NORTH, RANGE 05 EAST, TOWN OF ROME, ADAMS COUNTY, WISCONSIN

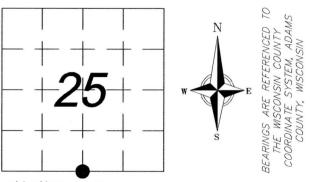

(b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence, or any other material evidence you considered, and whether the monument was found or placed.

I found a Harrison Monument 6"± below grade of a sand/dirt road per tie sheet by Wayne Basler, dated, 6-15-81. I accepted the Harrison Monument (see picture), and placed four (4) ties all as referenced below. Date of field survey & monument recovery was September 03, 2015. Elevations provided on section corners are based upon the NAVD88 Datum.

**LEGEND** 


(c) In the plan view drawing below, provide reference ties to at least 4 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron, or other equally durable material.) Describe witness monuments.

(d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate North.

NORTH 1/4 Cor. 25–20–05 HARRISON MONUMENT FOUND WITH TOP BROKEN OFF

SCALE: 1"=40'

## SECTION CORNER MONUMENT FOUND

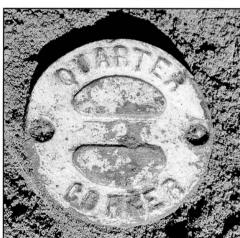

SET  $^{3}$ /4"ø × 18" SOLID IRON RE-ROD, MIN. WT. 1.50 lbs., SOUTH ¼ Cor. 25–20–05 RRISON MONUMENT FOUND MEASURED COORDINATES: N=292835,978 E=52288,994 HAR Z=1004.35N89°53'15"W 2646.73 S65.25'11"W

NO'44'36"W 5274.85 N82'09'58"E 50.23 S89'53'04"E 2647.97 SOUTHEAST Cor. 25-20-05 HARRISON MONUMENT FOUND

SOUTHWEST Cor. 25–20–05 HARRISON MONUMENT FOUND WITH TOP 16" BROKEN OFF

(e) Describe any material discrepancy between the location of the corner as restored or re-established and the location of that corner as previously restored or re-established by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or re-established and (1) the corner as restored or re-established, and (2) to at least 2 of the 4 witness monuments shown on the drawing in (d), above.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

Found perpetuated location.

(g&h) Was the corner re-established through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location.

Found perpetuated location.

(i) I, Michael S. Marty, Professional Land Surveyor No. 2452, hereby certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my

vichal S. Maty y: Vierbicher Associates, Inc. Michael S. Marty, P.L.S. No. 2452

9/22/2015 Date

ierbicher

22 Sep 2015 - 9:19a

planners | engineers | advisors

FN- 150044 DATE: 09/22/2015 Drafted By: MMAR

Checked By: MZIE

M:\Sand Valley\150044 Town of Rome Site\CADD\150044\_Tie Sheets.dwg by: mmar

1111111111 SCONS MICHAEL S. MARTY S-2452 NEW GLARUS WI SURV 11/1/11/11/11

Affix Land Surveyor Seal