30 SECTION

# OT RANGE ADAMS COUNTY COUNTY CORNER NO: 103 ROMPORTOL ID: 41807300000

## PUBLIC LAND SURVEY MONUMENT RECORD

**HARRISON** TYPE OF MONUMENT: ADAMS COUNTY COORDINATES, NAD 83 (2007)

N. **229777.327** 

E. 562356.888

ELEVATION-DATUM - - -

01/16/2020 FIELD WORK DATE:


### BASIS FOR MONUMENT LOCATION

1977 - PLS 1103 RAN EDM/T2 TRAVERSE AROUND SECTIONS 31 AND 32 AND TO ADJACENT SECTION CORNERS TO DETERMINE SEARCH AREAS FOR INVESTIGATION. EXCAVATION WITH BACKHOE YIELDED NO EVIDENCE OF THE ORIGINAL CORNER OR ANY REMONUMENTATION. COULD FIND NO EVIDENCE OF ANY BEARING TREES FROM THE ORIGINAL GOVERNMENT SURVEY. RELOCATED CORNER BY WEIGHTING OCCUPATION AND ORIGINAL DISTANCES, SETTING HARRISON MONUMENT ON THE CENTERLINE OF CZECH AVE AND OPPOSITE AN ANCIENT FENCE TO THE NORTH.

2020 - PLS 2675 FOUND HARRISON MONUMENT 18"± BELOW THE ROAD SURFACE AND 2 WITNESSES. THE MONUMENT AGREES WITH BOTH WITNESSES, ACCEPTED THE HARRISON MONUMENT AS THE CORNER LOCATION. SET 4 NEW TIES AND MEASURED TO THE EXISTING WITNESSES.



(INDICATE CORNER BY "X")

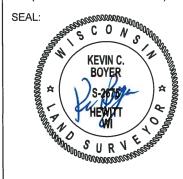

DATA SHOWN HERE ON THIS TIE SHEET IS CORRECT AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

PROFESSIONAL LAND SURVEYOR 2020

### -TIE SKETCH

NOTE: THE CORNER LANDS 1'± NORTH OF THE CENTERLINE OF CZECH AVE.



GATE N50°W MIXED WOODS OVER GROWN **CZECH** AVE.

SET 3/4" x 18" IRON REBAR, 1.50#/FT

FOUND HARRISON MONUMENT

VINYL "T" POST

WITNESS TREE

3" GATE POST

PINE PLANTATION

## **Government Land Corner Certificate**

ADAMS	County
TYPE OF MONUMENT: HAR	· ·
STATE PLANE COORDINATES:	N
	E
ELEVATION — M.S.L. DATUM	f:
THETA ANGLE:	
FIELD BOOK: 54	PAGE <u>/8</u>
DRAWN BY: D.C. HAG	EN

## BASIS FOR MONUMENT LOCATION


Show info such as: History of corner, with reference to Vol. and pg., dates, surveyor; exact description of monument replaced; if location computed, by taped or EDM traverse; landowner remarks, etc. (Use reverse side if necessary)

Ran EDM/T2 traverse around Sections 31 and 32 and to adjacent section corners to determine search areas for investigation.

Excavation with backhoe yielded no evidence of the original corner or any remonumentation. Could find no evidence of any bearing trees from the original government survey.

Relocated corner by weighting occupation and original distances, setting this corner on the centerline of Czech Avenue and opposite an ancient fence to the North.

Set Harrison on8-15-77.

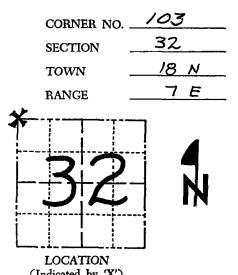

SEAL:



DATA SHOWN HERE ON CERTIFIED CORRECT:

Registered Land Surveyor

DATE: 9-14-77

## TIE SKETCH-

Show at least four ties, also fence lines, roads, topo, size and type of witness trees' and if off road - best way to arrive at corner.

## NOTE

Ties in trees to nail in disc.

#### MAINTENANCE RECORD

Init.	Remarks
6R-55	0.K.
55	· //
KZ-36	1-GONE I-NEW CORNER OK.
J6-55	2. GONE, 2- NEW COR OF
JG	OK
JC-55	ok
	6R-55 55 kZ-J6 J6-55

